

---

To: Outback MAX™ Users  
From: Global Customer Care  
Date: January 1, 2019  
Subject: Outback MAX v1.4.24.1.32174 Maintenance Build Update Instructions

---

**Product(s) Affected:**

Outback MAX, AC110

**Scope:**

This document provides software installation instructions for Outback MAX v1.4.24.1.32174. This software is required if using the same Outback MAX terminal with eDriveX/TC.

**Description of Changes:**


- AC110 – Improvements for switching rates with a Switch Box.
- AC110 – Polygons with rates of zero will now be displayed on RX maps.
- AC110 – Increased memory for large RX maps.
- AC110 – Up to 8 motorized sections available.
- ISOBUS- Task Controller improvements and additional compatibility
- BIOS- Updated to new BIOS to allow for software back backdating

To take advantage of the improvements listed above, visit [www.outbackguidance.com](http://www.outbackguidance.com) and navigate to the Software Updates page for the software downloads.


Note: GPS is required.

**Installation Instructions for Outback MAX v1.4.24.1.32174**

1. Download the Outback MAX v1.4.24.1.32174 software from the Outback Guidance website and save it to your computer.
2. Copy the OutbackMax-update-v1.4.24.1.32174.ota file to the USB drive provided in your Outback MAX kit.
3. Verify the Outback MAX terminal is powered on. Insert the USB drive in either of the USB ports on the MAX terminal.

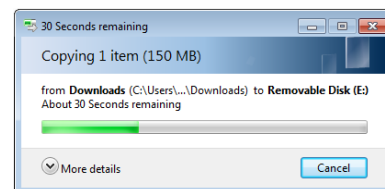

4. Navigate to the “Software Update” page located in the “Diagnostics” Menu.

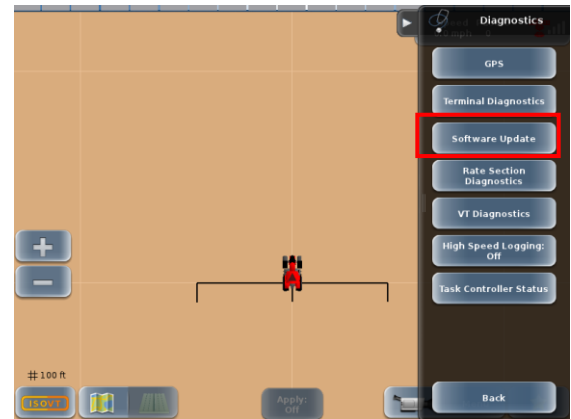

5. Press the “Install Update” button to copy the update to the MAX terminal. This step is only copying the file onto the MAX, and will only take a few minutes.




6. When the copy process is complete, a message appears indicating it is safe to power down the terminal to begin the update process.


**NOTE: You must hold the power button until the unit is powered down.**

7. Then remove the thumbdrive before powering the unit back on. You will see the AgJunction splash screen for several minutes before the Update messages begin to appear.

**Update process will take about 45 min.**

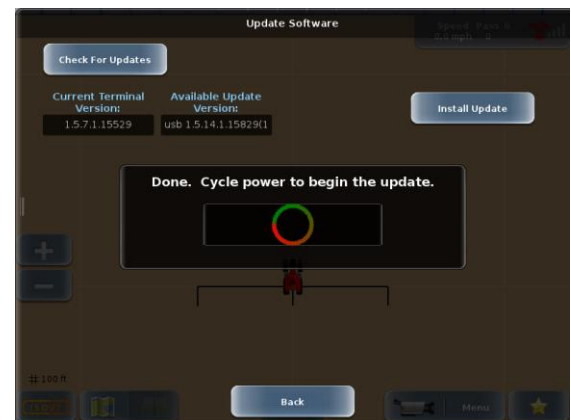

8. When the terminal prompts you, reboot the terminal a second time to finish the load process.

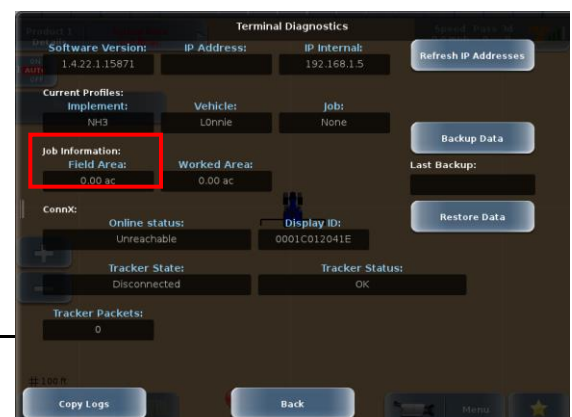

9. After the update process is complete, verify the new software version, in the MAX terminal press **Menu > Diagnostics > Terminal Diagnostics**. The version is displayed in the Software Version field.